

Document ID: 5619376

#PIT5752: SPS Programming Issues / No Communication / IPC Gauges Erratic / Various IPC Warning MILs / Certain Cruise Control Speeds Will Not Set / Communication DTCs - (Jun 12, 2020)

Subject: SPS Programming Issues / No Communication / IPC Gauges Erratic / Various IPC Warning MILs / Certain Cruise Control Speeds Will Not Set / Communication DTCs




Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Silverado 1500 (New Model)	2019		All		All	All
Chevrolet	Silverado	2020		All		All	All
GMC	Sierra 1500 (New Model)	2019		All		All	All
GMC	Sierra	2020		All		All	All

Involved Region or Country	North America
Condition	<p>You may encounter any of the following issues</p> <ul style="list-style-type: none"> - IPC warning lights or messages - IPC gauges erratic - Cruise control may not set or not set at a certain speed

© 2020 General Motors. All rights reserved.

<ul style="list-style-type: none"> - No Communication with various modules - Any of the following DTC's: U0073, U0100, U0101, U0102, U0121, U0128, U0131, U0140, U0415, U0422, U2413, and/or P0700 	
	<p>The cause of these concerns could be an aftermarket device plugged inline with the BCM X1 connector, shown below. These aftermarket devices are typically installed to change the speed calibration when a different size wheel/tire is installed. These devices are not supported or recommended by GM and will void the vehicle's warranty.</p>

Cause

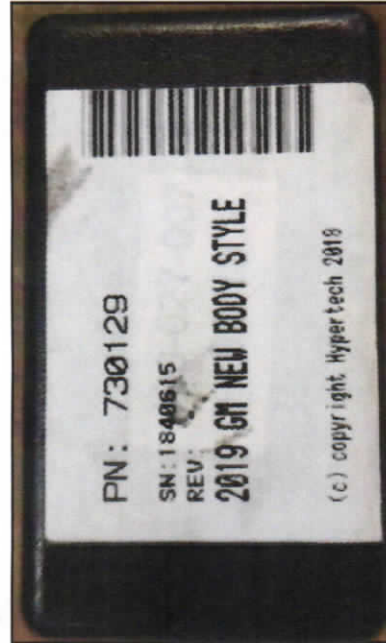

Correction

Before any in depth repairs are made, inspect the truck for this type of device. This device will be plugged inline with the BCM X1 © 2020 General Motors. All rights reserved.

Note: If the vehicle is modified with a lift kit, lowering kit, different size wheels/tires, etc. it is a good indication there could be one of these devices installed.

[Warranty Information](#)

Any concerns or damage that occurs as a result of vehicle modification will not be covered under the Terms of the New Vehicle Limited Warranty. Reference the latest version of TSB 09-00-89-016 (Warranty Administration – Labor Operation 0600014 – Suspected Tampering or Vehicle Modifications) if needed.

[Additional SI Keywords](#)

Black Widow Rocky Ridge Service Parking Brake C060B C0610 B1A01 B3623 C0277 C1596 P175F P1761 P30BD U0104 U0129 U0146 U026A U18D7 U18DC

Version	1
Modified	06/12/2020 – Created on

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT
VOLUNTARY
TECHNICIAN
CERTIFICATION