

#1 - DIAG: DIAG

CUSTOMER STATES CUSTOMER STATES CHECK ENGINE LIGHT
HAS COME BACK ON. NOW HAS A VERY STRONG FUEL GAS S
MELL AND TRUCK IS STILL SHOWING A MISFIRE CODE SEE
RECENT REPAIRS

Caused by

p050d

performed fuel injector balance test. #7 injector
leaking around the housing of injector.

Corrected by Fuel Injector Replacement

Tech: DON GOODWIN (808)

Installed 12710481 :SL-N-INJECTOR KIT (03300-CT) Qty: 1

Installed 12677004 :SL-N-PIPE (03163-CT) Qty: 1

Installed 12677002 :SL-N-PIPE (03163-CT) Qty: 1

4022330 Fuel Injector Replacement

2.1

.3 diag. 4 fuel injector balance test

Warranty

Warranty

Warranty

Warranty

#2 - MPVI: MULTI POINT VEHICLE INSPECTION

Sub Total: .00

#3 - DRI: DRIVEABILITY CHECK ENGINE OR SERVICE ENGINE LIGHT ON

customer states check engine light is on and
truck seems to be missing / running rough

Caused by