


Body Side Rear Window Garnish Molding Replacement

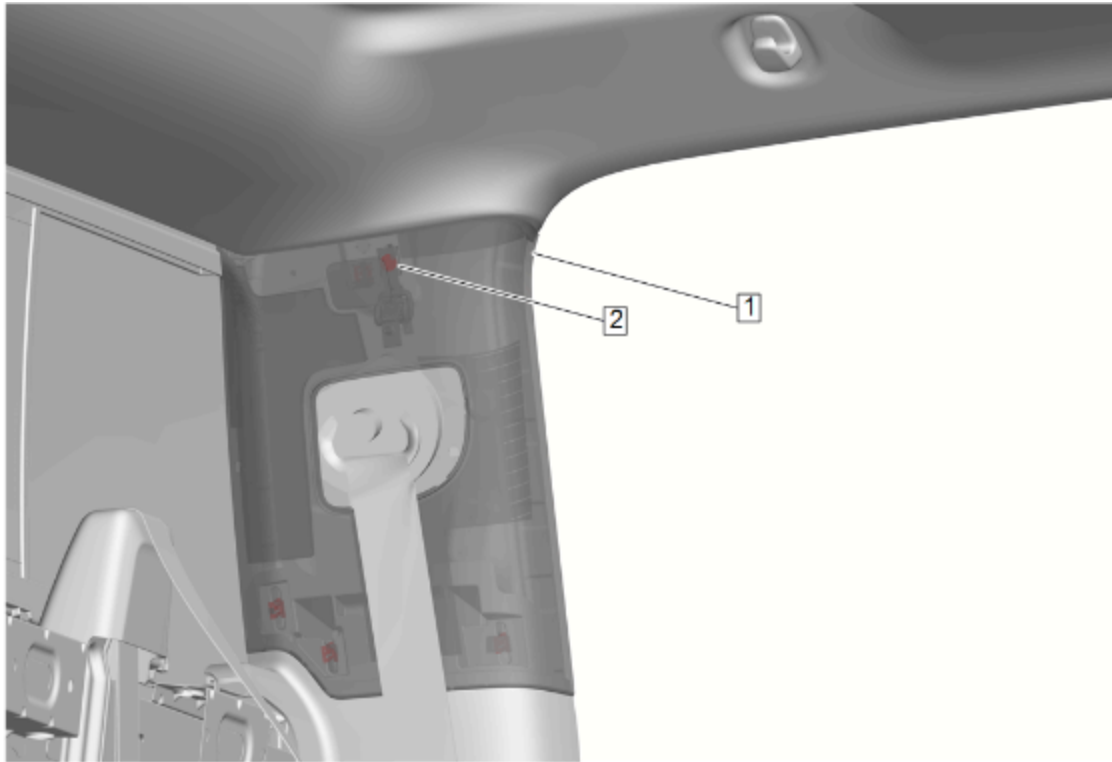

Body Side Rear Window Garnish Molding Replacement

Callout	Component Name
<p>Caution: If a vehicle is equipped with a head curtain inflator module ensure that the inflator module and tether are undamaged. If tether or curtain airbag are damaged in any way, they must be replaced.</p>	
<p>Caution: Use care when working around the head curtain inflator module. Sharp tools may puncture the curtain airbag. If the head curtain inflator module is damaged in any way, it must be replaced.</p>	
<p>Preliminary Procedures</p> <ol style="list-style-type: none"> 1. Disable the SIR system. SIR Disabling and Enabling 2. Remove the rear seat belt retractor anchor plate bolt. Rear Seat Belt Retractor Replacement 	

© 2020 General Motors. All rights reserved.

Callout	Component Name
1	<p>Body Side Rear Window Garnish Molding</p> <p>Procedure</p> <p>Pull the body side rear window garnish molding rearwards to release the tether from the body side inner frame.</p>
2	<p>Quarter Window Trim Finish Panel Bolt</p> <p>Caution: Fastener Caution</p> <p>Note: Tether and Bolt are integral to the Body Side Rear Window Garnish Molding.</p> <p>Procedure</p> <ol style="list-style-type: none">1. Access the bolt which is located on the backside of the garnish molding and secures the tether to the body side inner frame.2. Disconnect the electrical connector.3. Enable the SIR System. SIR Disabling and Enabling <p>Tighten</p> <p>2.5 Y (22 lb in)</p>