

**Subject:** Roof Beacon (TRW) Switch Wiring Location/Access

**Models/Years Affected:** 2014-15 Chevrolet Silverado 1500 LD  
2014-15 GMC Sierra 1500 LD

**Affected:** 2015 Chevrolet Silverado 2500/3500 HD  
2015 GMC Sierra 2500/3500 HD  
With option TRW

**Origination Date:** February 6, 2015

**Revision Date:** N/A


## ADVISORY:

### Condition/Concern:

Customer and Upfitters may have made several inquiries in search of the location and access methods for the blunt cut wiring for the Roof Beacon provision option (TRW).  
NOTE: Blunt cut wires are only ~ 2 inches in length.

### Repair/Recommendation:

The following illustration are intended to provide information on wire locations and how to remove the center panel/section of the Overhead Console to gain access to the provided blunt cut wires.

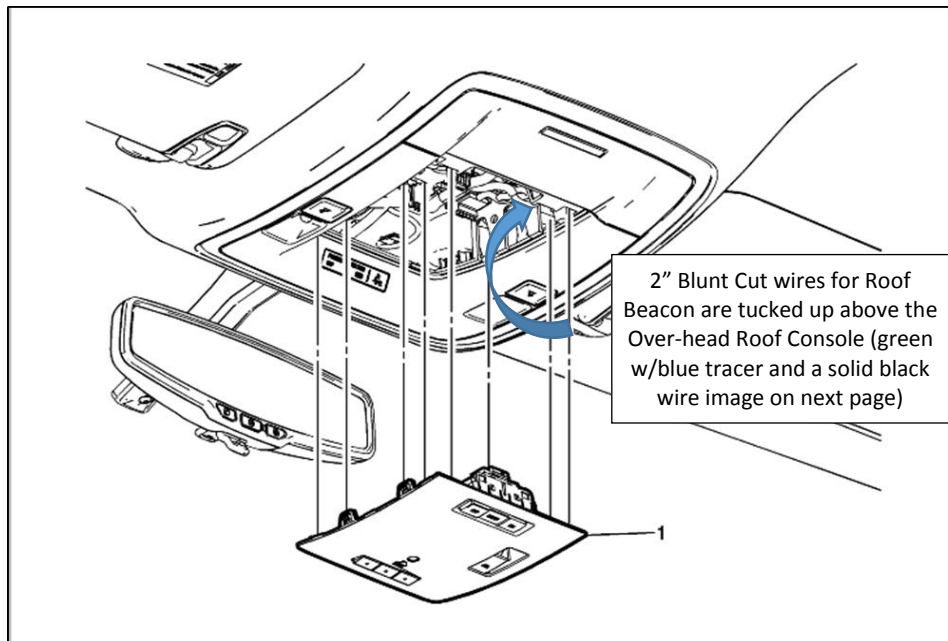

#### Roof Console Removal


To access the blunt cut wires for the roof beacon, remove center section of the Roof Console as follows...

1. Use a flat bladed plastic trim tool in order to release the retainer clips securing the trim plate to the roof console assembly.
2. Disconnect electrical connections where/when required.

**General Motors Upfitter Integration**

<http://www.gmupfitter.com> • 1-800-875-4742 (Upfitter Hotline)

**Removed Roof Console**

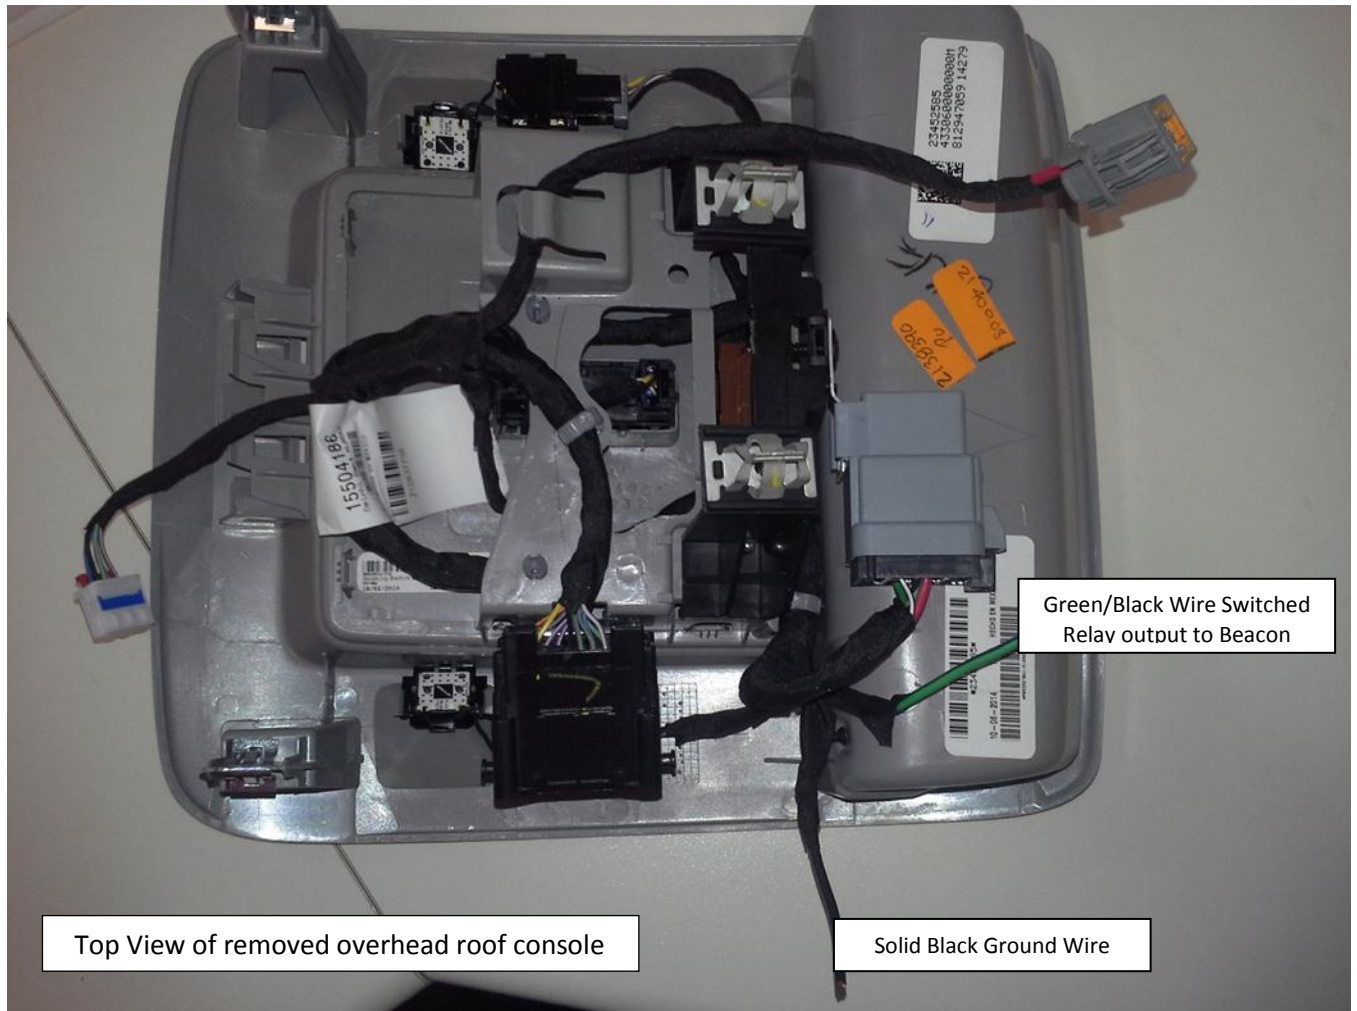

Top View of removed overhead roof console

Solid Black Ground Wire

Green/Black Wire Switched Relay output to Beacon

**Roof Beacon (TRW) Provision Schematic:**

