

<- Back


Forward ->

Document ID# 642952


2001 Chevrolet/Geo Chevy C Silverado - 2WD

Print

Enabling the SIR System

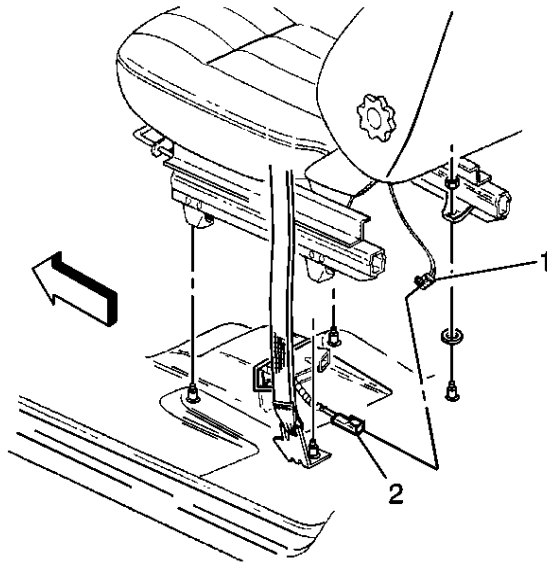


1. Remove the key from the ignition.
2. Connect the RF side impact module yellow 2-way connector (1) located under the passenger seat.
3. Install the connector position assurance (CPA) to the RF side impact module yellow 2-way connector (2) located under the passenger seat.
4. Connect the LF side impact module yellow 2-way connector (1) located under the driver seat.
5. Install the CPA to the LF side impact module yellow 2-way connector (2) located under the driver seat.

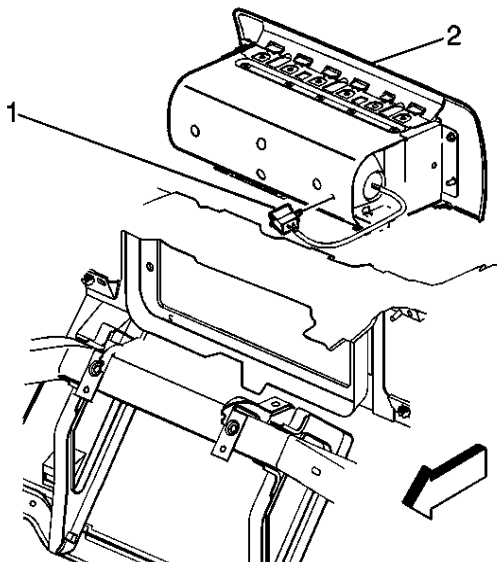



6. Connect the IP module yellow 2-way connector (1) located behind the main IP support.
7. Install the CPA to the IP module yellow 2-way connector (1) located behind the main IP support.

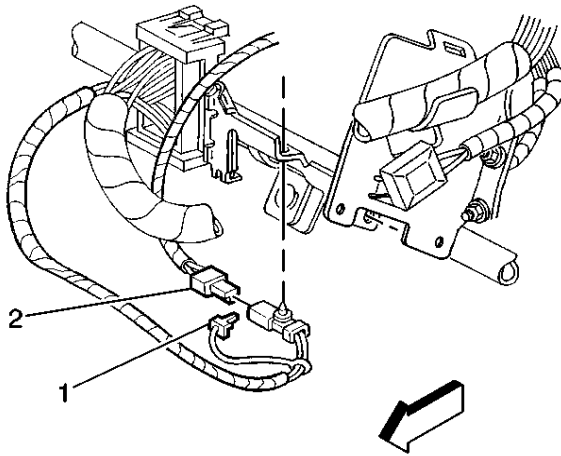

8. Connect the steering wheel module yellow 2-way connector (2) located at the base of the steering column.
9. Install the CPA (1) to the steering wheel module yellow 2-way connector (2) located at the base of the steering column.
10. Install the AIR BAG Fuse to the fuse block.
11. Staying well away from all air bags, turn ON the ignition, with the engine OFF.
 - A. The AIR BAG indicator will flash 7 times.
 - B. The AIR BAG indicator will then turn OFF.
12. Perform the [Diagnostic System Check - SIR](#) if the AIR BAG indicator does not operate as described.

[<- Back](#)[Forward ->](#)

Document ID# 642952
2001 Chevrolet/Geo Chevy C Silverado - 2WD

[Print](#)