


**X83 Auxiliary Audio Input X1 (AE7/AZ3)**

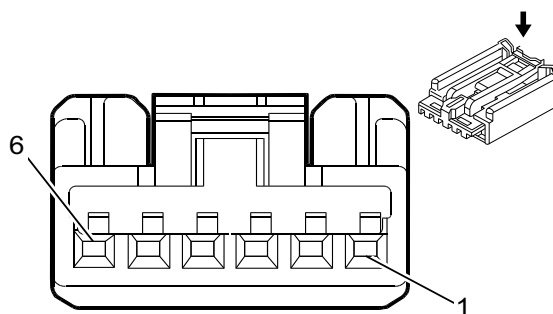

1862240

**Connector Part Information**

Harness Type: Center Seat  
 OEM Connector: AIT2PB-06-1AK  
 Service Connector: Service by Harness - See Part Catalog  
 Description: 6-Way F 0.64 Kaizen Series (BK)

**Terminal Part Information**

Terminal Type ID	Terminated Lead	Diagnostic Test Probe	Terminal Removal Tool	Service Terminal	Tray Name	Core Crimp	Insulation Crimp
I	Not Required	J-35616-64B (LT BU)	No Tool Required	Not Required	Not Required	Not Required	Not Required

**X83 Auxiliary Audio Input X1 (AE7/AZ3)**

Pin	Size	Color	Circuit	Function	Terminal Type ID	Option
1	0.35	GY	5839	Left Auxiliary Audio Signal 2	I	—
2	0.35	GN	5841	Right Auxiliary Audio Signal 2	I	—
3	0.35	VT	5843	Auxiliary Audio Common Signal	I	—
4	0.35	BK	2550	Ground	I	—
5	0.35	BU	2060	Auxiliary Detection Signal	I	—
6	0.75	RD/VT	340	Battery Positive Voltage	I	—