



Instrument Panel Lower Center Trim Panel Replacement - Left Side


Removal Procedure

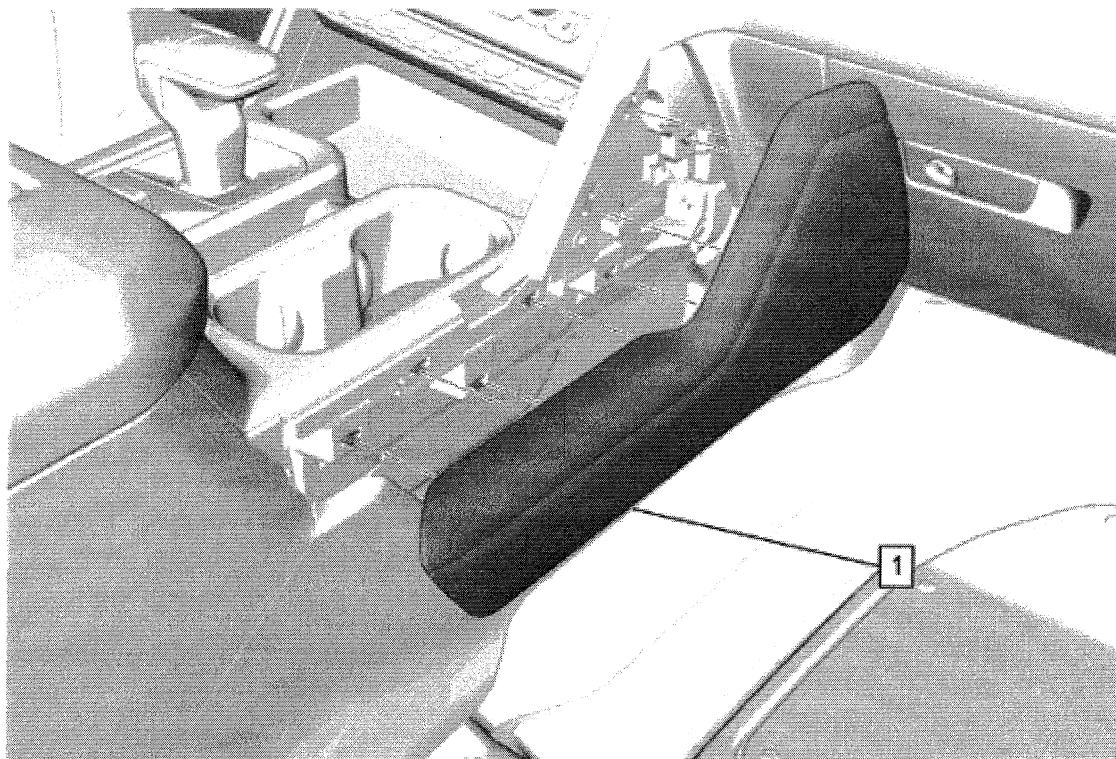

1. Using a flat-bladed plastic trim tool, release the retaining clips.
2. Front Floor Console Lower Applique - Right Side (1) » Remove

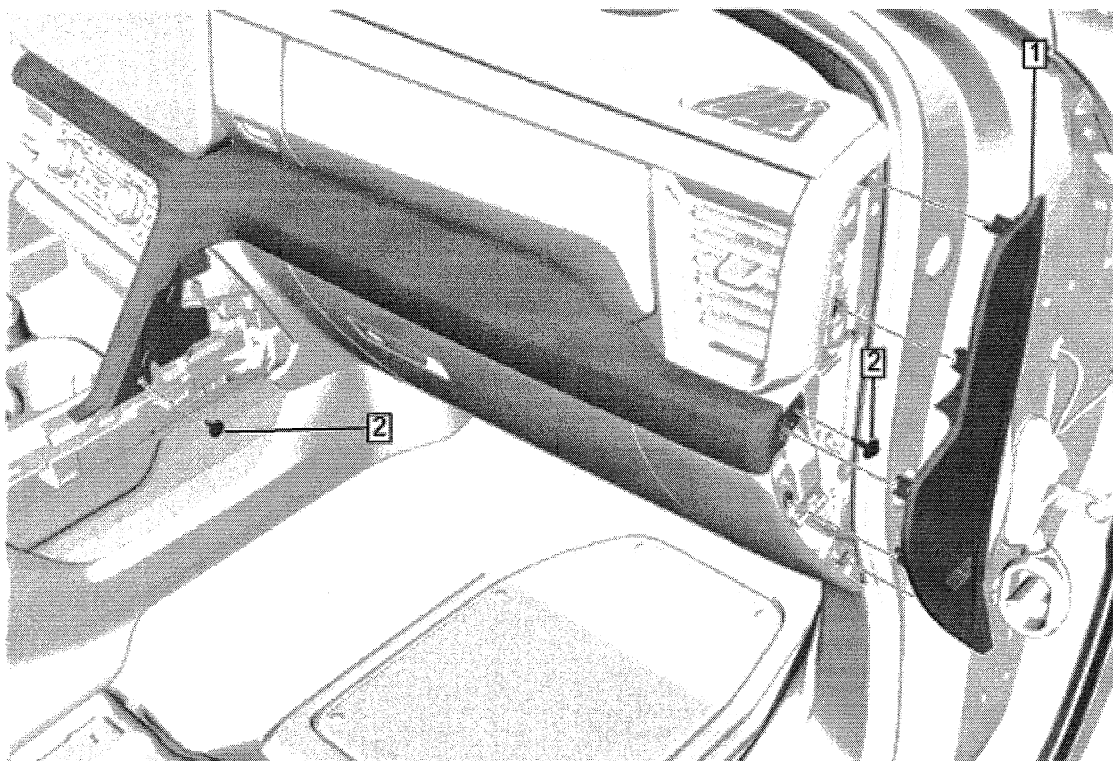


3. Using a flat-bladed plastic trim tool, release the retaining clips.
4. Instrument Panel Fuse Block Access Hole Cover (1) » Remove
5. Instrument Panel Trim Pad Bolt (2) » Remove [2x]

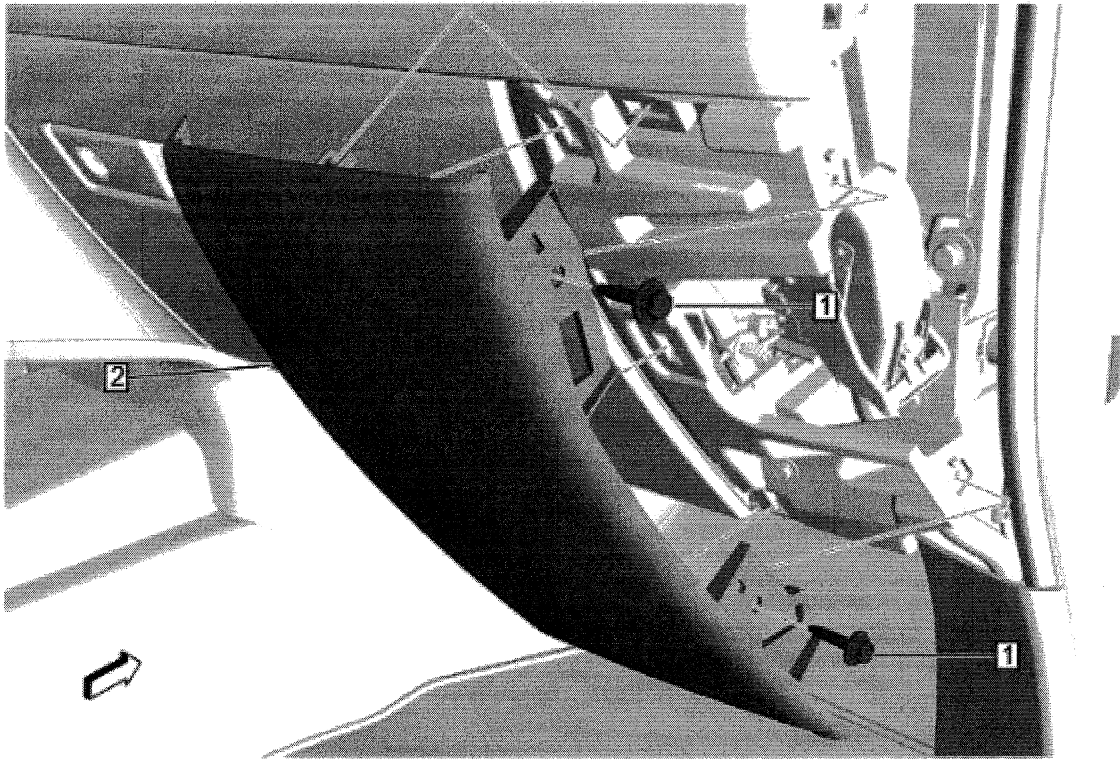


6. Instrument Panel Lower Trim Panel Outer Filler Bolt (1) » Remove [2x]

Note: Use a plastic trim tool if necessary.


7. Instrument Panel Lower Trim Panel Outer Filler (2) » Remove

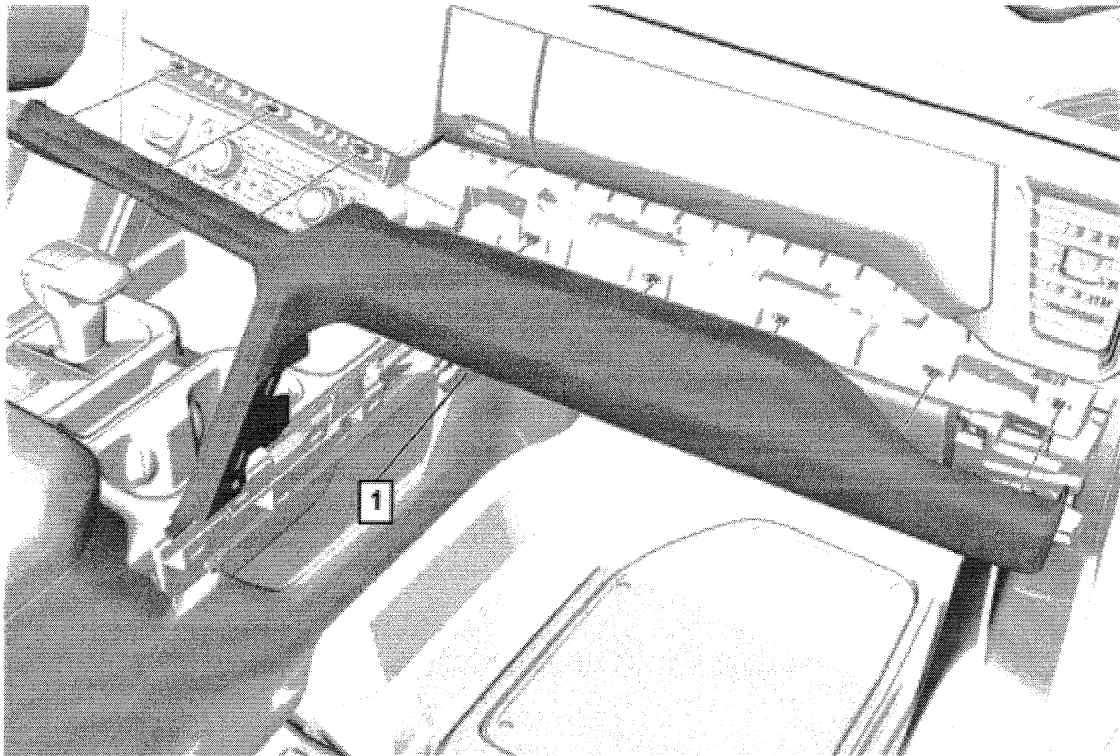

8. Using a flat-bladed plastic trim tool, release the retaining clips.
9. Instrument Panel Trim Pad - Right Side (1) » Remove

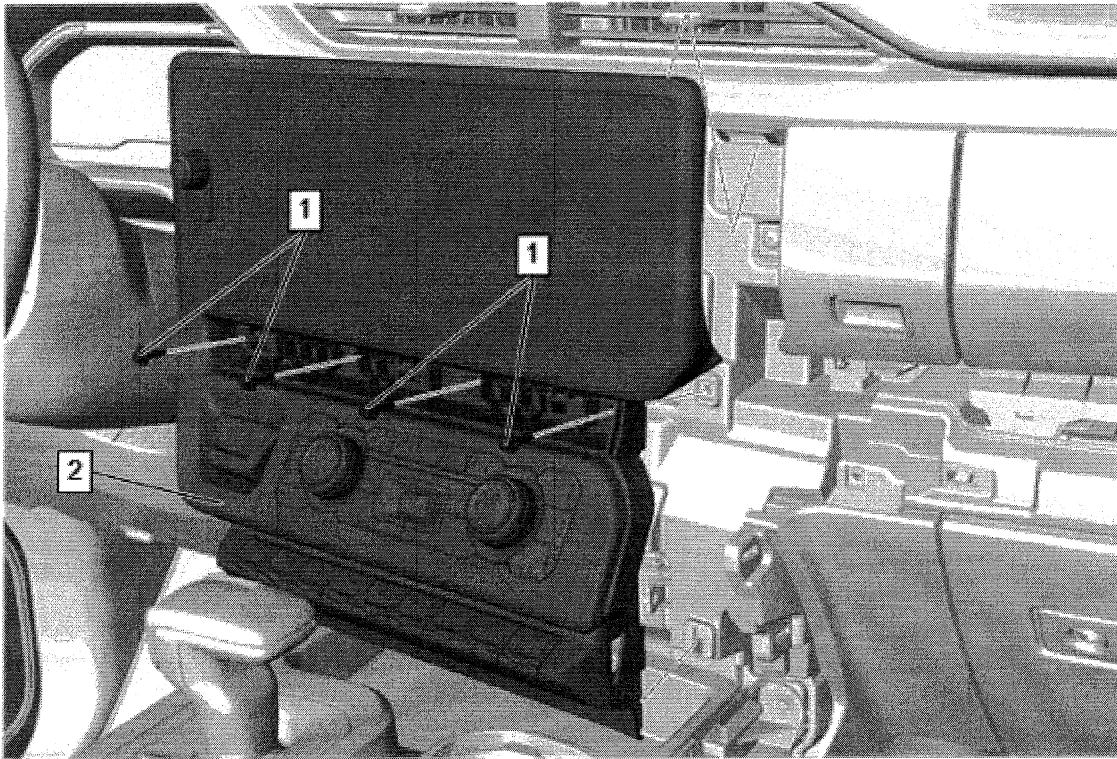


10. Radio Control Bolt (1) » Remove [4x]
11. Radio Control (2) » Remove
12. Disconnect the electrical connectors.

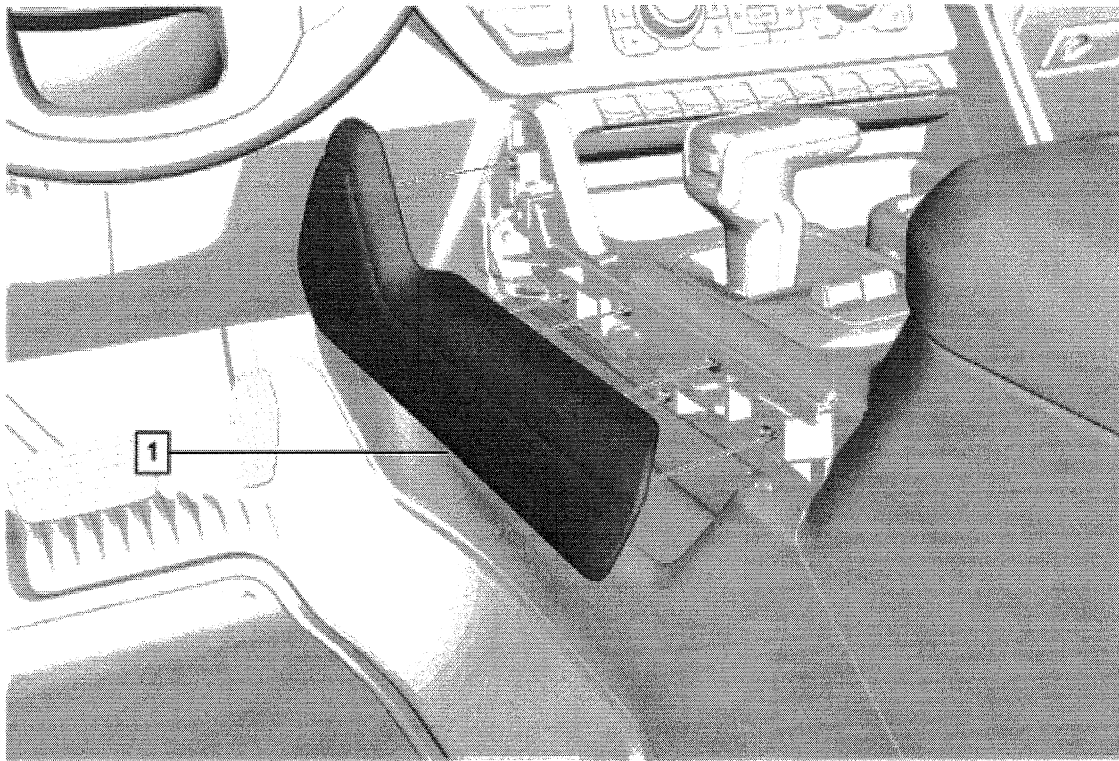


13. Using a flat-bladed plastic trim tool, release the retaining clips.

14. Front Floor Console Lower Applique - Left Side (1) » Remove

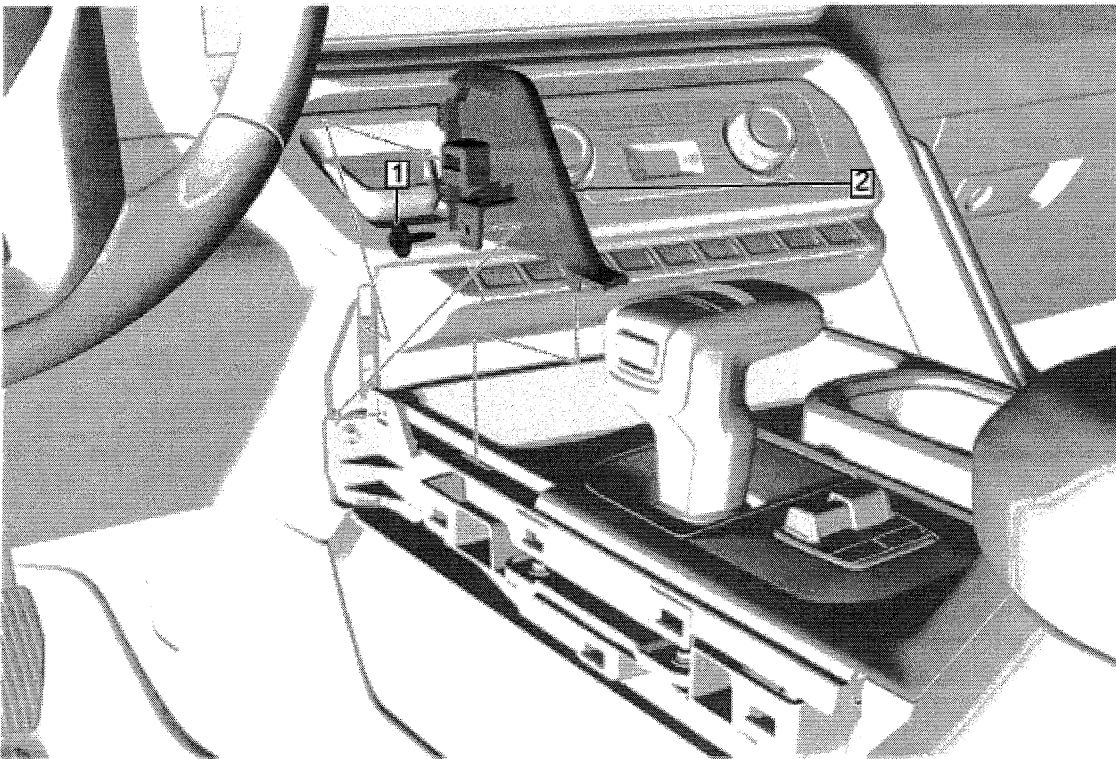

15. Front Floor Console Applique Bolt (1) » Remove

16. Front Floor Console Applique (2) » Remove

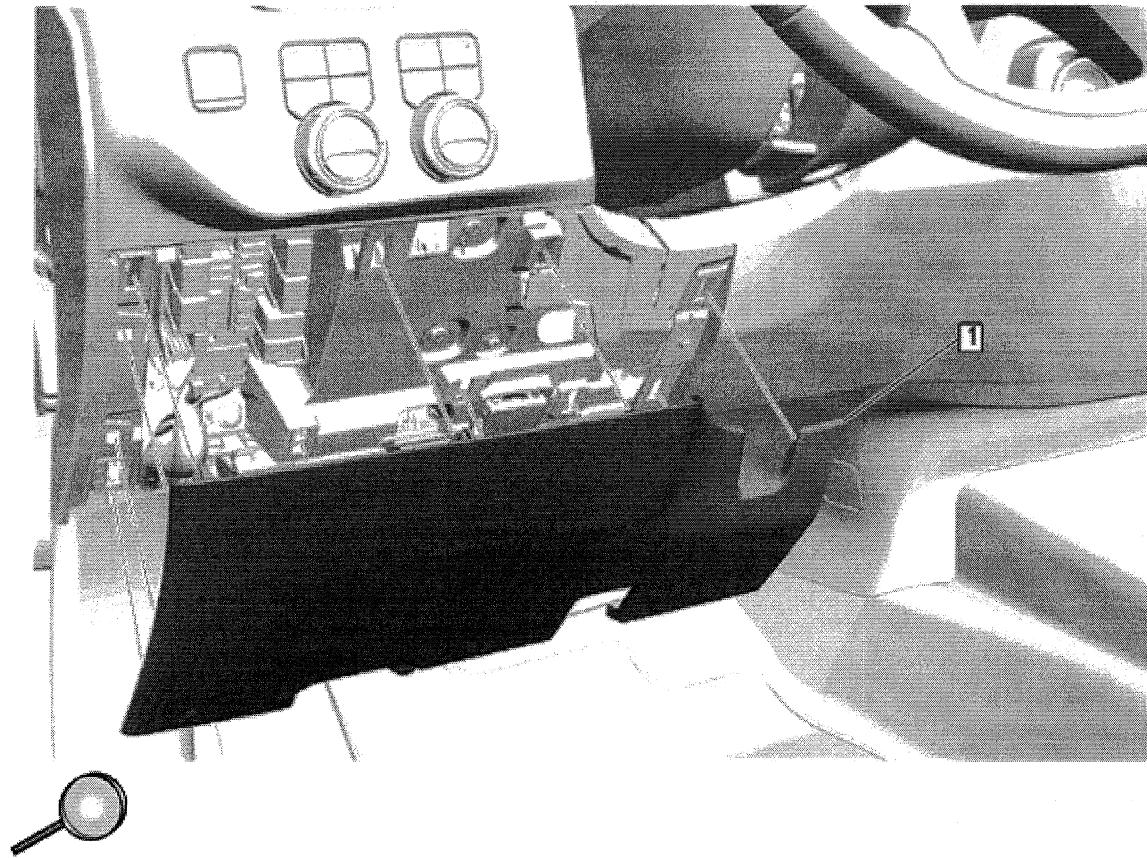


© 2024 General Motors. All rights reserved.

Warning: When removing, handling or installing this component wear protective gloves. The sharp edges on the component may be very sharp and may cause injury.

17. Using a flat-bladed plastic trim tool, release the retaining clips.

18. Instrument Panel Knee Bolster (1) » Remove

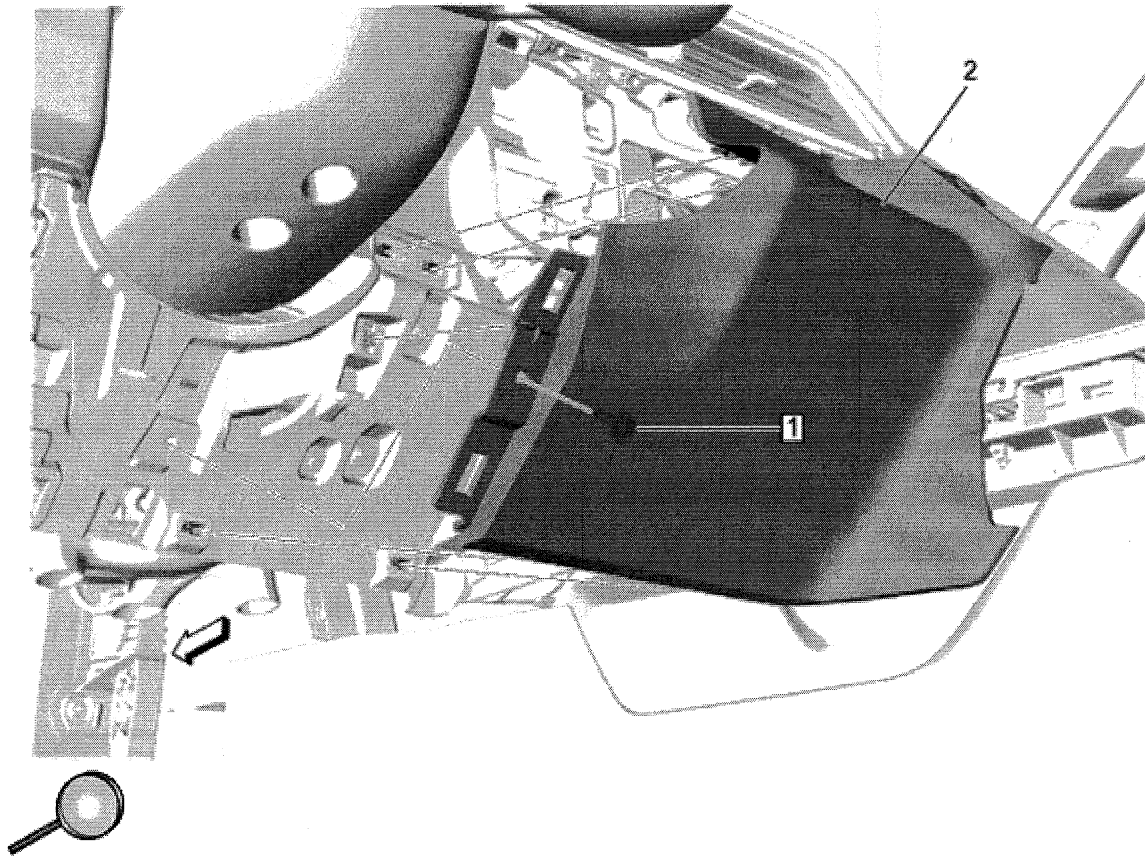

19. Instrument Panel Lower Center Trim Panel Bolt (1) » Remove

20. Using a flat-bladed plastic trim tool, release the retaining clips.

21. Instrument Panel Lower Center Trim Panel - Left Side (2) » Remove

Installation Procedure